

**St. Paul's School: 6-month Surveillance
May 2009**

001 - Schoolhouse

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Basement							
Basement Ceiling	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material is located above the plaster ceiling.
Basement Ceiling	Pipe Fittings	-----	TSI	Yes	MNO	MNO	
Electrical Room (017)	9" Floor Tile (black)	20 Sq.Ft.	Misc	No	Fair	MNO	Approximately 160 Sq. Ft. of material removed. Remainder of material is located under electrical switchgear cabinet.
Mechanical Room (008)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material is present within the wall to the trench.
Third Floor							
Room 312	9" Floor Tile (brown/white)	20 Sq. Ft.	Misc	No	Good	N/C	
Closet 1	9" Floor Tile (brown/white)	30 Sq. ft	Misc	No	Good	N/C	

Throughout
Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 01 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

002 Payson Science Center

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
First Floor							
Men's Room (110)	Ceramic Tile Grout/Mastic	260 Sq. Ft.	Misc	No	n/a	Good	Material not tested but assumed ACBM in recent NESHAP survey.
Women's Room (116)	Ceramic Tile Grout/Mastic	260 Sq. Ft.	Misc	No	n/a	Good	Material not tested but assumed ACBM in recent NESHAP survey.
1st Floor Hall (121)	9" Floor Tile (brown)	320 Sq. Ft.	Misc	No	Good	Fair	Heavy wear pattern in material near Mechanical Room door.
1st Floor Stairwell #1	9" Floor Tile (brown)	100 Sq. Ft.	Misc	No	Good	N/C	
1st Floor Stairwell #2	9" Floor Tile (brown)	100 Sq. Ft.	Misc	No	Good	N/C	
Second Floor							
2nd Floor Hall/Lobby (220)	9" Floor Tile (brown)	650 Sq. Ft.	Misc	No	Good	N/C	Material observed to be missing 4 tiles and some tiles concealed by walk-off mats taped to floor.
2nd Floor Stairwell #1	9" Floor Tile (brown)	350 Sq. Ft.	Misc	No	Good	N/C	Material observed to be chipped in corner of space.
Classroom/Lab (212)	Expansion Cloth	10 LF	Misc	No	n/a	MNO	Material originally identified in 1988 survey report.
Third Floor							
3rd Floor Hall (318)	9" Floor Tile (brown)	550 Sq. Ft.	Misc	No	Good	N/C	Materials observed to have slight lifting throughout.
3rd Floor Stairwell #1	9" Floor Tile (brown)	120 Sq. Ft.	Misc	No	Good	N/C	
3rd Floor Women's Bathroom	9" Floor Tile (black/white)	12 Sq. Ft.	Misc	No	Good	N/C	
Chem Lab (302)	Expansion Cloth	10 LF	Misc	No	n/a	MNO	Material originally identified in 1988 survey report.

continued on next page

Completed By:  Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

002 Payson Science Center

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Chem Lab (304)	Expansion Cloth	10 LF	Misc	No	n/a	MNO	Material originally identified in 1988 survey report.
Chem Lab (306)	Expansion Cloth	10 LF	Misc	No	n/a	MNO	Material originally identified in 1988 survey report.
Chem Lab (306)	Transite Panels	15 Sq. Ft.	Misc	No	n/a	MNO	Material not tested but assumed ACBM in recent NESHAP survey.
Bio-Chem Lab (309)	Transite Panels	15 Sq. Ft.	Misc	No	n/a	MNO	Material not tested but assumed ACBM in recent NESHAP survey.
Storage / Prep (310)	Expansion Cloth	10 LF	Misc	No	n/a	MNO	Material originally identified in 1988 survey report.
Lab Tech (311)	Expansion Cloth	10 LF	Misc	No	n/a	MNO	Material originally identified in 1988 survey report.
Attic							
Attic Stairwell	9" Floor Tile	100 sq. ft	Misc	No	MNO		Material has been covered over with rubber stairtreads.
Attic, Vent Hood	Expansion Cloth	10 lf.	Misc	No	Good		Material located on duct in middle of Fan Room.
Attic, Fume Hood	Chimney Mud	20 Sq. Ft.	TSI	No	Good		Materials located on three of four chimneys in Fan Room.

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

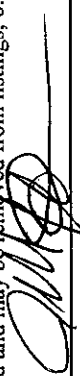
Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.


Completed By:  Date: 07 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

006 Moore

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Lower Level							
Mechanical Room	Pipe Insulation	Throughout	TSI	Yes	MNO	MNO	Material was not observed and may have been removed.
Janitor Room	9" Floor Tile (tan/brown)	72 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles.
Hall by Mech Room	9" Floor Tile (tan/brown)	36 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles.
Hall	9" Floor Tile (tan/brown)	105 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles.
Stairwells	9" Floor Tile (tan/brown)	196 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with rubber stairtreads.
Room 45	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 46	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 47	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 48	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 49	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Office B	9" Floor Tile (tan/brown)	200 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Office C	9" Floor Tile (tan/brown)	192 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.

continued on next page

Completed By:  Date: 01 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

006 Moore

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Upper Level							
Lobby & Entry Vestibule	9" Floor Tile (tan/brown)	484 Sq. Ft.	Misc	No	Fair	N/C	Material on stairs has been covered over with rubber treads.
Room 40	9" Floor Tile (tan/brown)	432 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 41	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 42	9" Floor Tile (tan/brown)	432 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 43	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 44	9" Floor Tile (tan/brown)	520 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Office (113)	9" Floor Tile (tan/brown)	200 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Vestibule by Office	9" Floor Tile (tan/brown)	81 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.

Throughout
Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.
Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.
Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.
Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

011 Hargate

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
First Floor							
Drafting Room	12" Floor tile (white)	100 sq. ft	Misc.	No	Fair	N/C	Materials were observed to have some lifting throughout.
Corridor							
Drafting Room (045) & Storage (046)	12" Floor tile (white)	300 sq. ft	Misc.	No	Good	N/C	
Gallery	12" Floor tile	1,500 sq. ft	Misc.	No	Good	MNO	Exhibition Gallery is a cork tile floor.
Second Floor							
North Apartment: Kitchen, Living Room	Transite	40 sq. ft	Misc.	No	Good	MNO	Material may be located behind radiator in Study/Living Room.
North Apartment: Kitchen	Floor Tile	150 sq. ft	Misc.	No	MNO	MNO	Materials have been covered over with newer flooring according to the records for the buildings.

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleanings; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By: *[Signature]* Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

013 Oates Music & Dance


Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 Year)	Condition May 2009	Notes
Music							
Exterior: West Side Music	Corrugated transit siding	800 sq. ft	Misc	No	Good	N/C	
Dance							
Exterior: North Side	Corrugated transit siding	1,500 sq. ft	Misc	No	Good	N/C	
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 01 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

051 New Chapel

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
First Floor							
Choir	Flooring Paper	675 sq. ft	Misc	Yes	MNO	MNO	Material is located under the wood flooring
Side Entrance near choir	Flooring Paper	100 sq. ft	Misc	Yes	MNO	MNO	
Rectory Hall	Flooring Paper	475 sq. ft	Misc	Yes	MNO	MNO	
Rectory	Flooring Paper	220 sq. ft	Misc	Yes	MNO	MNO	
Side Entrance to Chapel	Transite Board	40 sq. ft	Misc	No	Good	MNO	Material not found.


Exterior Other suspect exterior materials are present and further review is required. Prior to any exterior renovation and/or demolition a full NESHAP survey must be conducted in accordance with various state and federal regulations. Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5.

Completed By:  Date: 21 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

055 Memorial Hall

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Basement							
Women's Dressing Room (017)	9" Floor Tile (black/white)	175 Sq. Ft.	Misc	No	Good	N/C	
Unfinished Space (009)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material is located above ductwork.
Radio Station (008)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material is located above finished ceiling.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	
	Duct Skim Coat	-----	TSI	Yes	MNO	MNO	
Halls and entry to Ladies Room (002/004/007)	9" Floor Tile (black/white)	500 sq. ft	Misc	No	Good	N/C	
Storage / Coat closet (001)	9" Floor Tile (black/white)	80 sq. ft	Misc	No	Good	N/C	
First Floor							
Auditorium (105)	9" Floor Tile (brown)	4100 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to have chips and missing tiles present.
Second Floor/Mezzanine Level							
Balcony Lobby (201)	9" Floor Tile (black/white)	340 Sq. Ft.	Misc	No	Good	N/C	
North Stairwell (202)	9" Floor Tile (black/white)	28 Sq. Ft.	Misc	No	Good	N/C	

Continued on next page.

Completed By:  Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

055 Memorial Hall

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Balcony (206)	9" Floor Tile (brown)	2100 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to have chips and missing tiles present.
Auditorium & Balcony Ceiling	Trowel On Surfacing Material	6300 Sq. Ft.	Surf	Yes	Good	N/C	Material was observed to have small hole in center of ceiling.
Auditorium & Balcony Walls	Trowel On Surfacing Material	7800 Sq. Ft.	Surf	Yes	Good	N/C	
Attic/Balcony Level							
Mechanical Fan Room (301)	Duct Expansion Cloth	40 Linear Ft.	Misc	No	Good	N/C	Materials never tested but assumed to be ACM.
Projector Room (303)	Wire Cable Insulation	12 Linear Ft.	Misc	No	Good	N/C	

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

401 Alumni

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Basement							
Bathroom (011)	9" Floor Tile	18 Sq. Ft.	Misc	No	Good	Removed	All materials lifted due to plumbing leak. Tiles stored at Facilities for disposal during next abatement project.
First Floor							
Bathroom (104)	Linoleum	36 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Business Offices 102, 102B, 116, 119, 120 (previously ASP Office)	Floor Tile	486 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Business Office (107/108)	Floor Tile	486 Sq. Ft.	Misc	No	MNO	MNO	
Human Resources (110/111)	Floor Tile	405 Sq. Ft.	Misc	No	MNO	MNO	
Second Floor							
Bathroom (210) (previously A-1 Bath)	Linoleum	20 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Office (217) (previously Office Storage)	Linoleum	16 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Hall Closet (227)	Transite floor	10 sq. ft	Misc	No	Good	N/C	

Continued on next page.

Completed By:  Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

401 Alumni

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Hall Closet (228)	Transite floor	10 sq. ft	Misc	No	Good	N/C	
Office (219) (previously A-1 Kitchen)	Linoleum	63 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Third Floor							
Apt. 3, Bath	Linoleum	75 sq. ft	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Apt. 4, Bath	Linoleum	75 sq. ft	Misc	No	MNO	MNO	
Apt. 5, Bath	Linoleum	100 sq. ft	Misc	No	MNO	MNO	
Hall Closet (306)	Transite floor	10 sq. ft	Misc	No	MNO	MNO	Material assumed to be under carpeting.
Hall Closet (314)	Transite floor	10 sq. ft	Misc	No	MNO	Good	

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

402 Scudder House

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Basement	Pipe Insulation	632 lf	TSI	Yes	Damaged	N/C	Material appears to have had some repairs as newly installed wet wrap is present, however RPF did observe material with exposed edges and delaminating wrap and should be repaired or removed as soon as feasible.
	Pipe Fitting Insulation	79 observed	TSI	Yes	Damaged	N/C	
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

403 Red Barn

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
First Floor Mishop	Transite Ceiling Panel	600 sq. ft	Misc.	No	Good	N/C	Material observed to have a 3/4" hole in center of ceiling.

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleanings; 3. Conduct removal and cleanings; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 04 May 09

St. Paul's School: 6-month Surveillance

May 2009

404 Central Heating Plant

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Facilities Offices First Floor							
Office (104 & 105) (previously Facilities Director's Office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
Offices (103) (previously maintenance & secretaries office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
Offices (106, 107, & 108) (previously maintenance & secretaries office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.

Throughout
 Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.
 Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

406 Post Office

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
First Floor							
Post Master Area	9" Floor Tile and associated mastic	690 sq. ft	Misc.	No	Good	N/C	Approximately 60 sq. ft of material was removed for a new bathroom by Seacoast Diversified in 2004.
Post Master Area	Trowelled-On Surfacing Material	1,477 sq. ft	Misc.	Yes	Good	N/C	

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 04 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

410 Tuck Shop

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Food Storage (7)	Pipe Fitting Insulation	30 Observed	TSI	Yes	Good	N/C	
Storage Room (12)	Pipe Fitting Insulation	17 Observed	TSI	Yes	Good	N/C	
Mechanical Room (6)	Pipe Fitting Insulation	50 Observed	TSI	Yes	Good	N/C	
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 01 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

411 Service Building (White Farm/Shipping & Receiving)

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Basement Level Boiler Room	Transite Ceiling and Wall Panels	500 sq. ft	Misc.	No	Damaged	N/C	Rough edges should be covered or encapsulated. Broken panels and loose pieces should be removed and replaced with suitable material.


Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleanings; 3. Conduct removal and cleanings; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.


Completed By:  Date: 21 May 09

St. Paul's School: 6-month Surveillance
May 2009

414 Food Services

Location	ACBM	Approximate Quantity	Category	Frangible	Condition October 2006 (3 year)	Condition May 2009	Notes
Basement							
Crawlspace	Pipe Fittings	-----	TSI	Yes	MNO	MNO	
First Floor							
Common Room	Flooring Paper	1,700 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring.
Upper Dining Room	Flooring Paper	3,500 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring.
Second Floor							
Food Service Storage Rooms	Flooring Paper	240 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles in half of room.
	Ceiling Plaster	240 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks and half of ceiling appears to have been covered by sheetrock.
	Wall Plaster	750 sq. ft	Surf.	Yes	n/a	Fair	Material has some hairline cracks.
Men's Locker Room	Flooring Paper	200 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles.
	Ceiling Plaster	200 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered with sheetrock.
Men's Restroom	Wall Plaster	450 sq. ft	Surf.	Yes	n/a	Good	Material appears to have been covered with sheetrock.
	Flooring Paper	60 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles.
	Ceiling Plaster	60 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered with sheetrock.
Women's Locker Room	Wall Plaster	250 sq. ft	Surf.	Yes	n/a	Good	Material appears to have been covered with sheetrock.
	Flooring Paper	160 sq. ft	Misc.	MNO	MNO	MNO	Material is under wood flooring which has been covered by carpet.
	Ceiling Plaster	160 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered with sheetrock.
	Wall Plaster	400 sq. ft	Surf.	Yes	n/a	Good	Material has some hairline cracks.

Continued on next page.

Completed By:  Date: 21 May 09

St. Paul's School: 6-month Surveillance
May 2009

414 Food Services

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Women's Restroom	Flooring	80 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles.
	Paper			Yes			
	Ceiling Plaster	80 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered with sheetrock.
	Wall Plaster	300 sq. ft	Surf.	Yes	n/a	Good	Material has some hairline cracks.
Breakroom	Flooring	225 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by carpet.
	Paper			Yes			
	Ceiling Plaster	225 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered with sheetrock.
	Wall Plaster	480 sq. ft	Surf.	Yes	n/a	Good	Material has some hairline cracks.
Linen Storage	Flooring	225 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by linoleum.
	Paper			Yes			
	Linoleum	225 sq. ft	Misc.	No	n/a	Poor	Material is lifting and tearing.
	Ceiling Plaster	225 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered with sheetrock.
Corridor	Wall Plaster	480 sq. ft	Surf.	Yes	n/a	Fair	Material has some minor cracks.
	Flooring	100 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered half by carpet and half by 12" tiles.
	Paper			Yes			
	Ceiling Plaster	100 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered with sheetrock.
Third Floor Room 1	Wall Plaster	130 sq. ft	Surf.	Yes	n/a	Fair	Material is located outside of Women's Locker Room and Break Room and has some minor cracks.
	Ceiling Plaster	50 sq. ft	Surf.	Yes	Good	MNO	Material has been covered over with sheetrock.
	Wall Plaster	225 sq. ft	Surf.	Yes	Good	MNO	Material has been covered over with sheetrock.
	Ceiling Plaster	60 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
Third Floor Room 2	Wall Plaster	260 sq. ft	Surf.	Yes	Good	N/C	

Continued on next page.

Completed By:  Date: 01 May 09

St. Paul's School: 6-month Surveillance
May 2009

414 Food Services

Location	ACBM	Approximate Quantity	Category	Frangible	Condition October 2006 (3 year)	Condition May 2009	Notes
Room 3	Ceiling Plaster	100 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
Room 4	Wall Plaster	320 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
	Ceiling Plaster	100 sq. ft	Surf.	Yes	Good	N/C	
Room 5	Wall Plaster	320 sq. ft	Surf.	Yes	Good	N/C	Material has some paint peeling.
	Ceiling Plaster	120 sq. ft	Surf.	Yes	Good	N/C	
Room 6	Wall Plaster	350 sq. ft	Surf.	Yes	Good	N/C	Material has some minor cracks.
	Ceiling Plaster	110 sq. ft	Surf.	Yes	Good	N/C	
Linen Closet	Wall Plaster	340 sq. ft	Surf.	Yes	Good	N/C	Material has some minor cracks.
	Ceiling Plaster	12 sq. ft	Surf.	Yes	n/a	Good	
Room 7	Wall Plaster	130 sq. ft	Surf.	Yes	n/a	Good	Material has some hairline cracks.
	Ceiling Plaster	108 sq. ft	Surf.	Yes	Good	N/C	
Room 8	Wall Plaster	340 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
	Ceiling Plaster	100 sq. ft	Surf.	Yes	Good	N/C	
Room 9	Wall Plaster	320 sq. ft	Surf.	Yes	Good	N/C	Material has some paint peeling.
	Ceiling Plaster	100 sq. ft	Surf.	Yes	Good	N/C	
Room 10	Wall Plaster	320 sq. ft	Surf.	Yes	Good	N/C	Material has some minor cracks.
	Ceiling Plaster	100 sq. ft	Surf.	Yes	Good	N/C	
Room 11	Wall Plaster	320 sq. ft	Surf.	Yes	Good	N/C	Material has some minor cracks and some paint peeling.
	Ceiling Plaster	110 sq. ft	Surf.	Yes	Good	N/C	
	Wall Plaster	340 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.

Continued on next page.

Completed By:  Date: 01 May 09

St. Paul's School: 6-month Surveillance
May 2009

414 Food Services

Location	ACBM	Approximate Quantity	Category	Frangible	Condition October 2006 (3 year)	Condition May 2009	Notes
Room 12	Ceiling Plaster	90 sq. ft	Surf.	Yes	Good	N/C	
Custodial Closet	Wall Plaster	300 sq. ft	Surf.	Yes	Good	N/C	Material has some minor cracks and some paint peeling.
	Ceiling Plaster	25 sq. ft	Surf.	Yes	n/a	Good	Material has some cracking around pipe penetration.
Guest Bath	Wall Plaster	160 sq. ft	Surf.	Yes	n/a	Good	
	Flooring Paper	130 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles.
Resident Bath	Ceiling Plaster	130 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered with sheetrock and paint peeling in shower area.
	Wall Plaster	510 sq. ft	Surf.	Yes	Good	N/C	Material appears to have been covered partially with sheetrock.
Corridor	Flooring Paper	60 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by newer vinyl flooring.
	Ceiling Plaster	60 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
Old Stairwell	Wall Plaster	260 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks and some paint peeling.
	Flooring Paper	360 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by carpet.
Fourth Floor Storage by stairwell	Ceiling Plaster	360 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
	Wall Plaster	1200 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
Bath	Ceiling Plaster	50 sq. ft	Surf.	Yes	n/a	Good	
	Wall Plaster	275 sq. ft	Surf.	Yes	n/a	Fair	Material has some cracking.
Bath	Ceiling Plaster	40 sq. ft	Surf.	Yes	n/a	Good	Material appears to have been covered with sheetrock.
	Wall Plaster	210 sq. ft	Surf.	Yes	n/a	Good	Material appears to have been covered with sheetrock.
Fourth Floor	Ceiling Plaster	80 sq. ft	Surf.	Yes	n/a	Fair	Material has some cracking, holes, and paint peeling.
	Wall Plaster	275 sq. ft	Surf.	Yes	n/a	Good	Material has some paint peeling.

Continued on next page.

Completed By:  Date: 21 May 09

**St. Paul's School: 6-month Surveillance
May 2009**

414 Food Services

Location	ACBM	Approximate Quantity	Category	Frangible	Condition October 2006 (3 year)	Condition May 2009	Notes
Room 16	Flooring	120 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Paper						
	Ceiling Plaster	140 sq. ft	Surf.	Yes	n/a	Fair	Material has some cracking, holes, and paint peeling.
	Wall Plaster	350 sq. ft	Surf.	Yes	n/a	Good	
Room 17	Flooring	110 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Paper						
	Ceiling Plaster	130 sq. ft	Surf.	Yes	n/a	Fair	Material has some cracking and holes.
	Wall Plaster	340 sq. ft	Surf.	Yes	n/a	Good	Material has some minor cracks.
Room 18	Flooring	160 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Paper						
	Ceiling Plaster	180 sq. ft	Surf.	Yes	n/a	Good	Material has some minor cracks and paint peeling.
	Wall Plaster	410 sq. ft	Surf.	Yes	n/a	Good	
Linen Closet	Flooring	50 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Paper						
	Ceiling Plaster	50 sq. ft	Surf.	Yes	n/a	Good	
	Wall Plaster	225 sq. ft	Surf.	Yes	n/a	Good	
Room 19	Flooring	160 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Paper						
	Ceiling Plaster	180 sq. ft	Surf.	Yes	n/a	Fair	Material has some cracking, holes, and paint peeling.
	Wall Plaster	410 sq. ft	Surf.	Yes	n/a	Poor	Material has some cracks, paint peeling and mold growth.
Room 20	Flooring	140 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Paper						
	Ceiling Plaster	160 sq. ft	Surf.	Yes	n/a	Poor	Material has some major cracking.
	Wall Plaster	390 sq. ft	Surf.	Yes	n/a	Fair	Material has some cracking, holes, and paint peeling.

Continued on next page.

Completed By:  Date: 01 May 09

St. Paul's School: 6-month Surveillance

May 2009

414 Food Services

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition May 2009	Notes
Storage by Room 20 & 21	Flooring	16 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Paper						
	Ceiling Plaster	16 sq. ft	Surf.	Yes	n/a	Poor	Material has some major cracking.
	Wall Plaster	125 sq. ft	Surf.	Yes	n/a	Fair	Material has some minor cracks.
Room 21	Flooring Paper	200 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Ceiling Plaster	220 sq. ft	Surf.	Yes	n/a	Good	Material has some minor cracks.
	Wall Plaster	480 sq. ft	Surf.	Yes	n/a	Good	Material has some minor cracks and holes.
Corridor	Flooring Paper	300 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
	Ceiling Plaster	300 sq. ft	Surf.	Yes	n/a	Good	Material has some minor cracks.
	Wall Plaster	880 sq. ft	Surf.	Yes	n/a	Fair	Material has some minor cracks.

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 May 09