

**St. Paul's School: 6-month Surveillance
November 2008**

001 - Schoolhouse

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Basement							
Basement Ceiling	Pipe Insulation	-----	TSI	MNO	MNO	MNO	Material is located above the plaster ceiling
Basement Ceiling	Pipe Fittings	-----	TSI	MNO	MNO	MNO	
Electrical Room (008A)	9" Floor Tile	180 Sq. Ft.	Misc	No	Damaged	Removed	Materials removed June 2008.
Mechanical Room (008)	Pipe Insulation	-----	TSI	MNO	MNO	MNO	Material is present within the wall to the trench
Third Floor							
Room 312	9" Floor Tile (brown/white)	20 Sq. Ft.	Misc	No	Good	N/C	
Closet 1	9" Floor Tile (brown/white)	30 Sq. ft	Misc	No	Good	N/C	

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

002 Payson Science Center

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
First Floor							
1st Floor Hall	9" Floor Tile (brown)	320 Sq. Ft.	Misc	No	Good	N/C	
1st Floor Stairwell #1	9" Floor Tile (brown)	100Sq. Ft.	Misc	No	Good	N/C	
1st Floor Stairwell #2	9" Floor Tile (brown)	100Sq. Ft.	Misc	No	Good	N/C	
Second Floor							
2nd Floor Hall	9" Floor Tile (brown)	500 Sq. Ft.	Misc	No	Good	N/C	
2nd Floor Stairwell #1	9" Floor Tile (brown)	350 Sq. Ft.	Misc	No	Good	N/C	
2nd Floor Stairwell #2	9" Floor Tile (brown)	350 Sq. Ft.	Misc	No	Good	N/C	
2nd Floor Lobby	9" Floor Tile (brown)	800 Sq. Ft.	Misc	No	Good	N/C	Not able to observe all tiles because walk-off mats taped to floor.
Third Floor							
3rd Floor Hall	9" Floor Tile (brown)	930 Sq. Ft.	Misc	No	Good	N/C	Materials observed to have slight lifting throughout.
3rd Floor Stairwell #1	9" Floor Tile (brown)	200 Sq. Ft.	Misc	No	Good	N/C	
3rd Floor Women's Bathroom	9" Floor Tile (black/white)	12 Sq. Ft.	Misc	No	Good	N/C	

continued on next page

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

002 Payson Science Center

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Attic							
Attic	9" Floor Tile	100 sq. ft	Misc	MNO	MNO	N/C	Material has been covered over with rubber stairtreads.
Stairwell							
Attic, Vent Hood	Expansion Cloth	10 lf.	Misc	No	Good	N/C	Material located on duct in middle of Fan Room.
Attic, Fume Hood	Chimney Mud	20 Sq. Ft.	TSI	No	Good	N/C	Materials located on each of four chimneys in Fan Room.

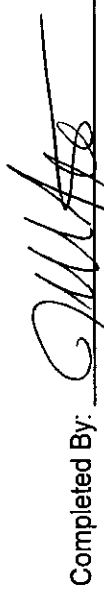
Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

006 Moore

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Lower Level							
Mechanical Room	Pipe Insulation	Throughout	TSI	MNO	MNO	MNO	Material was not observed and may have been removed.
Janitor Room	9" Floor Tile (tan/brown)	72 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles.
Hall by Mech Room	9" Floor Tile (tan/brown)	36 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles.
Hall	9" Floor Tile (tan/brown)	105 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles.
Stairwells	9" Floor Tile (tan/brown)	196 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with rubber stairtreads.
Room 45	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 46	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 47	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 48	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 49	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Office B	9" Floor Tile (tan/brown)	200 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Office C	9" Floor Tile (tan/brown)	192 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.

continued on next page

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

006 Moore

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Upper Level							
Lobby & Entry Vestibule	9" Floor Tile (tan/brown)	484 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to have chipped and lifting tiles along the stairs. Stairs scheduled to be covered with rubber treads.
Room 40	9" Floor Tile (tan/brown)	432 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 41	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 42	9" Floor Tile (tan/brown)	432 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 43	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 44	9" Floor Tile (tan/brown)	520 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Office	9" Floor Tile (tan/brown)	200 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Vestibule by Office	9" Floor Tile (tan/brown)	81 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.
Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.
Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.
Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

011 Hargate

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
First Floor							
Drafting Room	12" Floor tile (white)	100 sq. ft	Misc.	No	Fair	N/C	Materials were observed to have some lifting throughout
Corridor							
Drafting Room	12" Floor tile (white)	300 sq. ft	Misc.	No	Good	N/C	
Gallery	12" Floor tile	1,500 sq. ft	Misc.	No	Good	MNO	Exhibition Gallery is a cork tile floor.
Second Floor							
North Apartment: Kitchen, Living Room	Transite	40 sq. ft	Misc.	No	Good	MNO	
North Apartment: Kitchen	Floor Tile	150 sq. ft	Misc.	MNO	MNO	MNO	Materials have been covered over with newer flooring according to the records for the buildings.
Attic							
Over Gallery	Pipe Fitting Insulation	12 observed	TSI	Yes	Damaged	Removed	Materials removed June 2008.
Over Common Area	Pipe Fitting Insulation	19 observed	TSI	Yes	Damaged	Removed	
Theater Mechanical Room	Pipe Fitting Insulation	7 observed	TSI	Yes	Good	Removed	

continued on next page

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

011 Hargate

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Throughout							Possible inaccessible ACBM also.

Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

013 Oates Music & Dance

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 Year)	Condition November 2008	Notes
Music							
Exterior: West Side Music	Corrugated transit siding	800 sq. ft	Misc	No	Good	N/C	
Dance							
Exterior: North Side	Corrugated transit siding	1,500 sq. ft	Misc	No	Good	N/C	


Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

051 New Chapel

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
First Floor							
Choir	Flooring Paper	675 sq. ft	Misc	Yes	MNO	MNO	Material is located under the wood flooring
Side Entrance near choir	Flooring Paper	100 sq. ft	Misc	MNO	MNO	MNO	
Rectory Hall	Flooring Paper	475 sq. ft	Misc	MNO	MNO	MNO	
Rectory	Flooring Paper	220 sq. ft	Misc	MNO	MNO	MNO	
Side Entrance to Chapel	Transite Board	40 sq. ft	Misc	No	Good	N/C	Material is believed to be located behind radiator in South Vestibule.


Exterior Other suspect exterior materials are present and further review is required. Prior to any exterior renovation and/or demolition a full NESHAP survey must be conducted in accordance with various state and federal regulations. Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

055 Memorial Hall

Location	ACBM	Approximate Quantity	Category	Frangible	Condition October 2006 (3 year)	Condition November 2008	Notes
Basement							
Corridor (013)	Pipe Fitting Insulation	17 Observed	TSI	Yes	Good	Removed	All accessible materials removed June 2008.
Costume Shop (016)	Pipe Fitting Insulation	17 fittings	TSI	Yes	Damaged	Removed	
	Pipe Insulation	40 lf.	TSI	Yes	Damaged	Removed	
Trap Space (012)	Pipe Fitting Insulation	18 Observed	TSI	Yes	Damaged	Removed	
Electrical Room (010)	Pipe Fitting Insulation	13 Observed	TSI	Yes	Good	Removed	
	Pipe Insulation	27 Linear Ft.	TSI	Yes	Good	Removed	
Unfinished Space (009)	Pipe Fitting Insulation	43 Observed	TSI	Yes	Damaged	Removed	
	Pipe Insulation	309 Linear Feet.	TSI	Yes	Damaged	Removed	
Women's Dressing Room (017)	9" Floor Tile (black/white)	75 Sq. Ft.	Misc	No	Good	N/C	
Radio Station (008)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Can not observe pipe insulation present in this area further review may be required.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	
	Duct Skim Coat	-----	TSI	Yes	MNO	MNO	
Men's Room & Custodian Closet (006)	Pipe Insulation	12 Linear Ft.	TSI	Yes	Good	Removed	Materials removed June 2008.

Continued on next page.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

055 Memorial Hall

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Ladies' Room (004)	Pipe Insulation	9 Linear Ft.	TSI	Yes	Good	Removed	Materials removed June 2008.
Hall (002)	Pipe Insulation	15 Linear Ft.	TSI	Yes	Good	Removed	Materials removed June 2008.
	9" Floor Tile (black/white)	580 sq. ft	Misc	No	Good	N/C	
Storage / Coat closet (001)	Pipe Insulation	10 Linear Ft.	TSI	Yes	Good	Removed	Materials removed June 2008.
	Pipe Fitting Insulation	1 Observed	TSI	Yes	Good	Removed	Materials removed June 2008.
	9" Floor Tile (black/white)	80 sq. ft	Misc	No	Good	N/C	
First Floor							
Custodian Closet by Lobby(102)	Pipe Insulation	10 Linear Ft.	TSI	Yes	Good	Removed	Materials removed August 2008.
Auditorium (105)	9" Floor Tile (brown)	3249 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to have chips and missing tiles present.
Second Floor/Mezzanine Level							
Balcony Lobby (201)	9" Floor Tile (black/white)	340 Sq. Ft.	Misc	No	Good	N/C	
North Stairwell (202)	9" Floor Tile (black/white)	110 Sq. Ft.	Misc	No	Good	N/C	
Auditorium & Balcony Ceiling	Trowel On Surfacing Material	3249 Sq. Ft.	Surf	Yes	Good	N/C	Material was observed to have small hole in center of ceiling.

Continued on next page.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

055 Memorial Hall

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Balcony (206)	9" Floor Tile (brown)	1197 Sq. Ft.	Misc	No	Fair		Material was observed to have chips and missing tiles present.
Auditorium & Balcony Walls	Trowel On Surfacing Material	570 Sq. Ft.	Surf	Yes	Good		

Attic/Balcony Level

Mechanical Fan Room (301)	Pipe Insulation	108 Linear Ft.	TSI	Yes	Damaged	Removed	Materials removed August 2008.
	Pipe Fitting Insulation	19 Observed	TSI	Yes	Damaged	Removed	Materials removed August 2008.
	Duct Skim Coat	150 sq. ft	TSI	Yes	Good	Removed	Materials removed August 2008.
	Duct Expansion Cloth	40 Linear Ft.	Misc	No	Good	N/C	Materials never tested but assumed to be ACM.
Projector Room (303)	Wire Cable Insulation	12 Linear Ft.	Misc	No	Good	N/C	


Throughout
Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

120 Coit / Upper

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Basement							
Pelican Room (former Storage D)	Ceiling Patch	-----	Surf.	MNO	----	----	Confirmation testing was performed on the material and was found to be non-detect for asbestos and may be removed from the listing.
Basement Corridor	Ceiling Plaster	3,000 sq. ft	Surf.	Yes	----	----	
Storage A	Ceiling Plaster	400 sq. ft	Surf.	Yes	----	----	
Storage B	Ceiling Plaster	300 sq. ft	Surf.	Yes	----	----	
Basement	Ceiling	500 sq. ft	Surf.	Yes	----	----	

Other material locations previously listed here are now listed under site 414 Food Services.


Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.	Possible inaccessible ACBM also.
------------	---	----------------------------------

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

401 Alumni

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Basement							
Bathroom (011)	9" Floor Tile	18 Sq. Ft.	Misc	No	Good	Fair	Materials observed to be lifting around toilet basin.
First Floor							
Bathroom (104)	Linoleum	36 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Business Offices 102, 102B, 116, 119, 120 (previously ASP Office)	Floor Tile	486 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Business Office (107/108)	Floor Tile	486 Sq. Ft.	Misc	No	MNO	MNO	
Human Resources (110/111)	Floor Tile	405 Sq. Ft.	Misc	No	MNO	MNO	
Second Floor							
Bathroom (210) (previously A-1 Bath)	Linoleum	20 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Office (217) (previously Office Storage)	Linoleum	16 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Hall Closet (227)	Transite floor	10 sq. ft	Misc	No	Good	N/C	

Continued on next page.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

401 Alumni

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 Year)	Condition November 2008	Notes
Hall Closet (228)	Transite floor	10 sq. ft	Misc	No	Good	N/C	
Office (219) (previously A-1 Kitchen)	Linoleum	63 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.

Third Floor

Apt. 1, Bath	Linoleum	75 sq. ft	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Apt. 4, Bath	Linoleum	75 sq. ft	Misc	No	MNO	MNO	
Apt. 5, Bath	Linoleum	100 sq. ft	Misc	No	MNO	MNO	
Hall Closet (306)	Transite floor	10 sq. ft	Misc	No	MNO	MNO	Material assumed to be under carpeting.
Hall Closet (314)	Transite floor	10 sq. ft	Misc	No	MNO	Good	

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

402 Scudder House

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Basement							
Basement	Pipe Insulation	632 lf	TSI	Yes	Damaged	N/C	Material appears to have had some repairs as newly installed wet wrap is present, however RPF did observe material with exposed edges and delaminating wrap and should be repaired or removed as soon as feasible. 8 LF removed for heating system repair.
	Pipe Fitting Insulation	79 observed	TSI	Yes	Damaged	N/C	3 fittings removed for heating system repair.
First Floor							
Bathroom	Linoleum	50 sq. ft	Misc.	MNO	MNO	MNO	
Hall to Bathroom	Linoleum	20 sq. ft	Misc.	MNO	MNO	MNO	
Second Floor							
Bathroom	9" Floor Tile	75 sq. ft	Misc.	No	Good	-----	After reviewing the initial AHERA inventories and sampling results the material was found to be non-detect for asbestos.

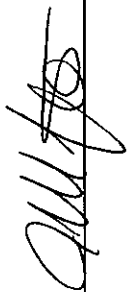
Throughout
 Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 07 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

403 Red Barn

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
----------	------	----------------------	----------	---------	---------------------------------	-------------------------	-------

First Floor							
Mishop	Transite Ceiling Panel	600 sq. ft	Misc.	No	Good	N/C	

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 26 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

404 Central Heating Plant

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Facilities Offices First Floor							
105) (previously Facilities Director's Office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
Offices (103) (previously maintenance & secretaries office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
Offices (106, 107, & 108) (previously maintenance & secretaries office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.


Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 26 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

406 Post Office

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
First Floor Post Master Area	9" Floor Tile and associated mastic	690 sq. ft	Misc.	No	Good	N/C	Approximately 60 sq. ft of material was removed for a new bathroom by Seacoast Diversified in 2004
Post Master Area	Trowelled-On Surfacing Material	1,477 sq. ft	Misc.	Yes	Good	N/C	

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.


Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 21 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

410 Tuck Shop

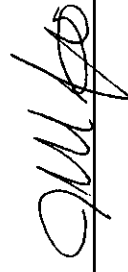
Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes	
Food Storage (7)	Pipe Fitting Insulation	30 Observed	TSI	Yes	Good	N/C		
Food Storage (7)	Pipe Fitting Insulation	4 Observed	TSI	Yes	Poor	Removed	Material removed June 2008.	
Room (12)	Pipe Fitting Insulation	17 Observed	TSI	Yes	Good	N/C		
Mechanical Room (6)	Pipe Fitting Insulation	50 Observed	TSI	Yes	Good	N/C		
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						Possible inaccessible ACBM also.	

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.

Completed By:  Date: 26 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

411 Service Building (White Farm/Shipping & Receiving)

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Basement Level							
Boiler Room	Transite Ceiling and Wall Panels	500 sq. ft	Misc.	No	Damaged	N/C	Rough edges should be covered or encapsulated. Broken panels and loose pieces should be removed and replaced with suitable material.

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.


Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Response Codes: 1. Manage ACBM in accordance with Management Plan; 2. Conduct repairs and cleaning; 3. Conduct removal and cleaning; 4. Material suspect and requires further testing; 5. ACBM has been removed and may be removed from listings; 6. ACBM was not observed and further review is required. See further discussion and requirements in report.


Completed By:  Date: 25 Nov 08

**St. Paul's School: 6-month Surveillance
November 2008**

414 Food Services

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Basement							
Crawlspace	Pipe Fittings	-----	TSI	MNO	MNO	MNO	
First Floor							
Common Room	Flooring Paper	1,400 sq. ft	Misc.	MNO	MNO	MNO	Material is under wood flooring
Upper Dining Room	Flooring Paper	3,000 sq. ft	Misc.	MNO	MNO	MNO	Material is under wood flooring
Second Floor							
Food Service's Break Room, Linen Storage, Lockers, and Storage	Flooring Paper	700 sq. ft	Misc.	MNO	MNO	MNO	Material is under wood flooring which has been covered by carpet and 12" tiles in most rooms.
	Ceiling Plaster	700 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks in Storage.
Third Floor							
Room 1	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	MNO	Material has been covered over with sheetrock.
	Wall Plaster	400 sq. ft	Surf.	Yes	Good	MNO	Material has been covered over with sheetrock.
Room 2	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
Room 3	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
Room 4	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	MNO	Material has some hairline cracks. Room inaccessible.
	Wall Plaster	400 sq. ft	Surf.	Yes	Good	MNO	Room inaccessible.

Continued on next page.

Completed By:  Date: 2/6/08

St. Paul's School: 6-month Surveillance
November 2008

414 Food Services

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2006 (3 year)	Condition November 2008	Notes
Room 5	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	MNO	Room inaccessible.
Room 6	Wall Plaster	400 sq. ft	Surf.	Yes	Good	MNO	Room inaccessible.
	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	
Room 7	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	
	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	
Room 8	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	
	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	
Room 9	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	
	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	
Room 10	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	
Room 11	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	Material has some hairline cracks.
	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	
Room 12	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	
	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	
Men's Bath	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	
Men's Bath and Shower	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	
	Flooring Paper	50 sq. ft	Misc.	MNO	MNO	MNO	
Corridor	Ceiling Plaster	75 sq. ft	Surf.	Yes	Good	N/C	Material is under wood flooring
	Wall Plaster	400 sq. ft	Surf.	Yes	Good	N/C	

Continued on next page.

Completed By:  Date: 26 Nov 08

