

**St. Paul's School: 6-month Surveillance
November 2011**


001 - Schoolhouse

Location	ACBM	Approximate Quantity	Category	Friable	Condition November 2009 (3 year)	Condition November 2011	Notes
Basement							
Basement Ceiling	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material is located above the plaster ceiling.
Basement Ceiling	Pipe Fittings	-----	TSI	Yes	MNO	MNO	
Electrical Room (017)	9" Floor Tile (black)	20 Sq.Ft.	Misc	No	Fair	MNO	Approximately 160 Sq. Ft. of material removed. Remainder of material is located under electrical switchgear cabinet.
Third Floor							
Room 312	9" Floor Tile (brown/white)	20 Sq. Ft.	Misc	No	Good	N/C	
Closet 1	9" Floor Tile (brown/white)	30 Sq. ft	Misc	No	Good	N/C	
Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work. Possible inaccessible ACBM also.							

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Completed By:  Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

002 Payson Science Center

Location	ACBM	Approximate Quantity	Category	Friable	Condition November 2009 (3 year)	Condition November 2011	Notes
First Floor							
1st Floor Hall (121)	9" Floor Tile (brown)	320 Sq. Ft.	Misc	No	Fair	n/a	Removed August 2011.
1st Floor Stairwell #1	9" Floor Tile (brown)	100 Sq. Ft.	Misc	No	Good	n/a	Removed August 2011.
1st Floor Stairwell #2	9" Floor Tile (brown)	100 Sq. Ft.	Misc	No	Good	n/a	Removed August 2011.
Second Floor							
2nd Floor Hall/Lobby (220)	9" Floor Tile (brown)	650 Sq. Ft.	Misc	No	Good	n/a	Removed August 2011.
2nd Floor Stairwell #1	9" Floor Tile (brown)	350 Sq. Ft.	Misc	No	Good	n/a	Removed August 2011.
Classroom/Lab (212)	Expansion Cloth	5 LF	Misc	No	Good	n/a	Removed November 2011.
Third Floor							
3rd Floor Hall (318)	9" Floor Tile (brown)	550 Sq. Ft.	Misc	No	Good	n/a	Removed August 2011.
3rd Floor Stairwell #1	9" Floor Tile (brown)	120 Sq. Ft.	Misc	No	Good	n/a	Removed August 2011.
3rd Floor Women's Bathroom	9" Floor Tile (black/white)	12 Sq. Ft.	Misc	No	Good	n/a	Removed August 2011.
Chem Lab (302)	Expansion Cloth	10 LF	Misc	No	Good	n/a	Removed November 2011.
continued on next page							
Chem Lab (304)	Expansion Cloth	10 LF	Misc	No	Good	n/a	Removed November 2011.
Chem Lab (306)	Expansion Cloth	10 LF	Misc	No	Good	n/a	Removed November 2011.

Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

002 Payson Science Center

Location	ACBM	Approximate Quantity	Category	Friable	Condition November 2009 (3 year)	Condition November 2011	Notes
Chem Lab (306)	Transite Panels	15 Sq. Ft.	Misc	No	n/a	n/a	Removed November 2011.
Bio-Chem Lab (309)	Transite Panels	15 Sq. Ft.	Misc	No	n/a	n/a	Removed November 2011.
Storage / Prep (310)	Expansion Cloth	10 LF	Misc	No	n/a	n/a	Removed November 2011.
Lab Tech (311)	Expansion Cloth	10 LF	Misc	No	n/a	n/a	Removed November 2011.
Attic							
Attic Stairwell	9" Floor Tile	100 sq. ft	Misc	No	MNO	n/a	Removed August 2011.
Attic, Vent Hood	Expansion Cloth	10 lf.	Misc	No	Good	n/a	Removed November 2011.
Attic, Fume Hood	Chimney Mud	20 Sq. Ft.	TSI	No	Good	n/a	Removed November 2011.
Exterior							
All Exterior Windows	Window Glaze	1550 LF	Misc	No	n/a	n/a	Removed November 2011.
All Exterior Windows	Window Caulk	1200 LF	Misc	No	n/a	n/a	Removed November 2011.
All Exterior Windows	Storm Window Caulk	1000 LF	Misc	No	n/a	n/a	Removed November 2011.

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material, TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.


Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

006 Moore

Location	ACBM	Approximate Quantity	Category	Friable	Condition November 2009 (3 year)	Condition November 2011	Notes
Lower Level							
Janitor Room	9" Floor Tile (tan/brown)	72 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles. Scheduled for removal December 2011.
Hall by Mech Room	9" Floor Tile (tan/brown)	36 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles. Scheduled for removal December 2011.
Hall	9" Floor Tile (tan/brown)	105 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to be lifting with some spot replacement tiles. Scheduled for removal December 2011.
Stairwells	9" Floor Tile (tan/brown)	196 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with rubber stairtreads.
Room 45	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 46	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 47	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 48	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 49	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Office B	9" Floor Tile (tan/brown)	200 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Office C	9" Floor Tile (tan/brown)	192 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.

continued on next page

Completed By:  Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

006 Moore

Location	ACBM	Approximate Quantity	Category	Friable	Condition November 2009 (3 year)	Condition November 2011	Notes
Upper Level							
Lobby & Entry Vestibule	9" Floor Tile (tan/brown)	484 Sq. Ft.	Misc	No	Fair	N/C	Material on stairs has been covered over with rubber treads. Scheduled for removal December 2011.
Room 40	9" Floor Tile (tan/brown)	432 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet. Scheduled for removal December 2011.
Room 41	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 42	9" Floor Tile (tan/brown)	432 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 43	9" Floor Tile (tan/brown)	441 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet.
Room 44	9" Floor Tile (tan/brown)	520 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet. Scheduled for removal December 2011.
Office (113)	9" Floor Tile (tan/brown)	200 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet. Scheduled for removal December 2011.
Vestibule by Office	9" Floor Tile (tan/brown)	81 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpet. Scheduled for removal December 2011.
Throughout				Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.			
				Possible inaccessible ACBM also.			

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.



Completed By: _____ Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

011 Hargate

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
First Floor							
Drafting Room	12" Floor tile (white)	100 sq. ft	Misc.	No	Fair	N/C	Materials were observed to have some lifting throughout.
Corridor							
Drafting Room (045) & Storage (046)	12" Floor tile (white)	300 sq. ft	Misc.	No	Good	N/C	
Second Floor							
North Apartment: Kitchen, Living Room	Transite	40 sq. ft	Misc.	No	Good	Good	Material is located behind radiator in Study/Living Room.
North Apartment: Kitchen	Floor Tile	150 sq. ft	Misc.	No	MNO	MNO	Materials have been covered over with newer flooring according to the records for the buildings.

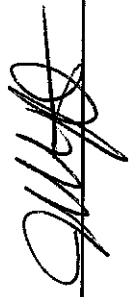
Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Completed By:  Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

013 Oates Music & Dance

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Music							
Exterior: West Side Music	Corregate d transit siding	800 sq. ft	Misc	No	Good	N/C	
Dance							
Exterior: North Side	Corregate d transit siding	1,500 sq. ft	Misc	No	Good	N/C	
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assesment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.



Completed By: _____ Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

051 New Chapel

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
First Floor							
Choir	Flooring Paper	675 sq. ft	Misc	Yes	MNO	MNO	Material is located under the wood flooring
Side Entrance near choir	Flooring Paper	100 sq. ft	Misc	Yes	MNO	MNO	
Rectory Hall	Flooring Paper	475 sq. ft	Misc	Yes	MNO	MNO	
Rectory	Flooring Paper	220 sq. ft	Misc	Yes	MNO	MNO	
Side Entrance to Chapel	Transite Board	40 sq. ft	Misc	No	Good	MNO	
Exterior							

Other suspect exterior materials are present and further review is required. Prior to any exterior renovation and/or demolition a full NESHAP survey must be conducted in accordance with various state and federal regulations.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.



Completed By: _____ Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

055 Memorial Hall

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Basement							
Women's Dressing Room (023)	9" Floor Tile (black/white)	175 Sq. Ft.	Misc	No	Good	N/C	
Theatre Storage (013)	Pipe Insulation	4 Linear Ft.	TSI	Yes	MNO	MNO	Material is located above ductwork.
Mechanical (012)	Pipe Insulation	20 Linear Ft.	TSI	Yes	MNO	n/a	Removed August 2011.
	Duct Skim Coat	50 Sq. Ft.	TSI	Yes	MNO	n/a	Removed August 2011.
	Duct Expansion Cloth	6 Linear Ft.	Misc	No	MNO	n/a	Removed August 2011.
	Radio Station (010)	Pipe Insulation	-----	Yes	MNO	MNO	Material is located above finished ceiling.
Hall and entry to Ladies Room (003)	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	
	Duct Skim Coat	-----	TSI	Yes	MNO	MNO	
	9" Floor Tile (black/white)	500 sq. ft	Misc	No	Good	N/C	
Storage (002)	9" Floor Tile (black/white)	80 sq. ft	Misc	No	Good	N/C	
Pipe Trench thru Rm. 022, 023, 023B, 024, 025, 026, 027, and	Pipe Insulation	-----	TSI	Yes	MNO	n/a	Removed December 2010 and August 2011.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	n/a	Removed December 2010 and August 2011.

Continued on next page.

Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

055 Memorial Hall

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
First Floor							
Stair hall (103)	9" Floor Tile (brown)	4100 Sq. Ft.	Misc	No	Fair	MNO	Material covered over by carpeting.
Auditorium (104)	9" Floor Tile (brown)	4100 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to have chips and missing tiles present. Some tiles covered over by carpeting.
Mezzanine Level							
Balcony Lobby (202)	9" Floor Tile (black/white)	340 Sq. Ft.	Misc	No	Good	N/C	
North Stairwell (203)	9" Floor Tile (black/white)	28 Sq. Ft.	Misc	No	Good	N/C	
Balcony Level							
Balcony (304)	9" Floor Tile (brown)	2100 Sq. Ft.	Misc	No	Fair	N/C	Material was observed to have chips and missing tiles present.
Auditorium Ceiling	Trowel On Surfacing Material	4800 Sq. Ft.	Surf	Yes	Good	N/C	Material was observed to have small hole in center of ceiling.
Balcony Textured Wall	Trowel On Surfacing Material	360 Sq. Ft.	Surf	Yes	Good	N/C	
Projector Room (303)	Wire Cable Insulation	12 Linear Ft.	Misc	No	Good	n/a	Removed December 2011.
Attic							
Mechanical Fan Room (401)	Duct Expansion Cloth	40 Linear Ft.	Misc	No	Good	N/C	Materials never tested but assumed to be ACM.

Continued on next page.

Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

055 Memorial Hall


Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Throughout							Possible inaccessible ACBM also.

Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

111 Nash

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
First Floor							
Student Room 10	9" Floor Tile	216 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 11	9" Floor Tile	231 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 12	9" Floor Tile	231 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 13	9" Floor Tile	231 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 14	9" Floor Tile	231 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 16	9" Floor Tile	216 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Hallway	9" Floor Tile	128 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Second Floor							
Student Room 20	9" Floor Tile	171 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 21	9" Floor Tile	121 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 22	9" Floor Tile	121 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 23	9" Floor Tile	121 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 24	9" Floor Tile	121 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 25	9" Floor Tile	171 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Student Room 26	9" Floor Tile	216 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.

Continued on next page.

Completed By:  Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

111 Nash

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Student Room 27	9" Floor Tile	216 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Hallway	9" Floor Tile	497 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

401 Alumni

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Basement							
Bathroom (011)	9" Floor Tile	18 Sq. Ft.	Misc	No	MNO	MNO	Materials were removed.
First Floor							
Bathroom (104)	Linoleum	36 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Business Offices 102, 102B, 116, 119, 120 (previously ASP Office)	Floor Tile	486 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Business Office (107/108)	Floor Tile	486 Sq. Ft.	Misc	No	MNO	MNO	
Human Resources (110/111)	Floor Tile	405 Sq. Ft.	Misc	No	MNO	MNO	
Second Floor							
Bathroom (210) (previously A-1 Bath)	Linoleum	20 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Office (217) (previously Office Storage)	Linoleum	16 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Hall Closet (227)	Transite floor	10 sq. ft	Misc	No	Good	N/C	

Continued on next page.

Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

401 Alumni

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Hall Closet (228)	Transite floor	10 sq. ft	Misc	No	Good	N/C	
Office (219) (previously A-1 Kitchen)	Linoleum	63 Sq. Ft.	Misc	No	MNO	MNO	Material has been covered over with carpeting.
Third Floor							
Apt. 3, Bath	Linoleum	75 sq. ft	Misc	No	MNO	MNO	Material has been covered over with newer flooring.
Apt. 4, Bath	Linoleum	75 sq. ft	Misc	No	MNO	MNO	
Apt. 5, Bath	Linoleum	100 sq. ft	Misc	No	MNO	MNO	
Hall Closet (306)	Transite floor	10 sq. ft	Misc	No	MNO	MNO	Material assumed to be under carpeting.
Hall Closet (314)	Transite floor	10 sq. ft	Misc	No	MNO	Good	
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.



Completed By: _____ Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

402 Scudder House

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Basement							
Basement	Pipe Insulation	632 lf	TSI	Yes	MNO	MNO	Materials were removed by ABS during summer of 2009.
	Pipe Fitting Insulation	79 observed	TSI	Yes	MNO	MNO	
Second Floor							
Bathroom	9" Floor Tile	75 Sq. Ft.	Misc.	No	Good	N/C	Prior to removal, testing is recommended.
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.



Completed By: _____ Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

403 Red Barn

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
First Floor							
Mishop	Transite Ceiling Panel	600 sq. ft	Misc.	No	Good	N/C	Material observed to have a 3/4" hole in center of ceiling.

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.

Completed By:  Date: ~~20~~Nov 11

St. Paul's School: 6-month Surveillance
November 2011

404 Central Heating Plant

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Facilities Offices First Floor							
Office (104 & 105) (previously Facilities Director's Office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
Offices (103) (previously maintenance & secretaries office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
Offices (106, 107, & 108) (previously maintenance & secretaries office)	Pipe Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
	Pipe Fitting Insulation	-----	TSI	Yes	MNO	MNO	Material may be above drop ceiling or within wall space.
Throughout							Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.



Completed By: _____ Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

406 Post Office

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
First Floor Post Master Area	9" Floor Tile and associated mastic	690 sq. ft	Misc.	No	Good	N/C	Approximately 60 sq. ft of material was removed for a new bathroom by Seacoast Diversified in 2004.
Post Master Area	Trowelled-On Surfacing Material	1,477 sq. ft	Misc.	Yes	Good	N/C	
Throughout	Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.						Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.



Completed By: _____ Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

411 Service Building (White Farm/Shipping & Receiving)

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Basement Level							
Boiler Room	Transite Ceiling and Wall Panels	500 sq. ft	Misc.	No	Damaged	N/C	Rough edges should be covered or encapsulated. Broken panels and loose pieces removed June 2010.


Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assessment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.


Completed By:  Date: 30 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

414 Food Services

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Basement							
Crawlspace	Pipe Fittings	-----	TSI	Yes	MNO	MNO	
First Floor							
Common Room	Flooring Paper	1,700 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring.
Upper Dining Room	Flooring Paper	3,500 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring.
Second Floor							
Food Service's Storage Rooms	Flooring Paper	240 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles in half of room.
Men's Locker Room	Flooring Paper	200 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles.
Men's Restroom	Flooring Paper	60 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles.
Women's Locker Room	Flooring Paper	160 sq. ft	Misc.	MNO	MNO	MNO	Material is under wood flooring which has been covered by carpet.
Women's Restroom	Flooring Paper	80 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles.
Breakroom	Flooring Paper	225 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by carpet.
	Linoleum	225 sq. ft	Misc.	No	n/a	MNO	Removed August 2011.
Linen Storage	Flooring Paper	225 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by linoleum.
	Linoleum	225 sq. ft	Misc.	No	n/a	Poor	Removed August 2011.
Corridor	Flooring Paper	100 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered half by carpet and half by 12" tiles.

continued on next page

Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

414 Food Services

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
Third Floor							
Guest Bath	Flooring Paper	130 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by 12" tiles.
Resident Bath	Flooring Paper	60 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by newer vinyl flooring.
Corridor	Flooring Paper	360 sq. ft	Misc.	Yes	MNO	MNO	Material is under wood flooring which has been covered by carpet.
Fourth Floor							
Room 16	Flooring Paper	120 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
Room 17	Flooring Paper	110 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
Room 18	Flooring Paper	160 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
Linen Closet	Flooring Paper	50 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
Room 19	Flooring Paper	160 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
Room 20	Flooring Paper	140 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
Storage by Rm 20 & 21	Flooring Paper	16 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
Room 21	Flooring Paper	200 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.
Corridor	Flooring Paper	300 sq. ft	Misc.	Yes	n/a	MNO	Material is under wood flooring.

continued on next page

Completed By:  Date: 20 Nov 11

**St. Paul's School: 6-month Surveillance
November 2011**

414 Food Services

Location	ACBM	Approximate Quantity	Category	Friable	Condition October 2009 (3 year)	Condition November 2011	Notes
----------	------	----------------------	----------	---------	---------------------------------	-------------------------	-------

Throughout Other suspect ACBM is present in and on the building that requires further review, testing, assesment and, based on the results modifications to the management plan may be required. In addition, interior and exterior inspection are required prior to any renovation or demolition work.

Possible inaccessible ACBM also.

Category: MISC is miscellaneous material; TSI is thermal system insulation; SURF is surfacing material. Categorized in accordance with 40 CFR Part 763.

Friable: Yes means that when dry, it can be easily crumbled or pulverized to powder by hand (ceiling tiles, plaster, pipe insulation, etc.). No means it is nonfriable (floor tiles, etc.). MNO means the material was not observed and further review is required.

Condition: N/C means no change was observed. N/A means no access was gained during the reinspection. MNO means the material was not observed and further review is required.



Completed By: _____ Date: 30 Nov 11